DOUBLE TRACK LOW HEADROOM TORSION SPRING INSTRUCTIONS

WUUL


WINDING CONE

SET SCREW.

VISE GF

TORSIO!

SHAFT

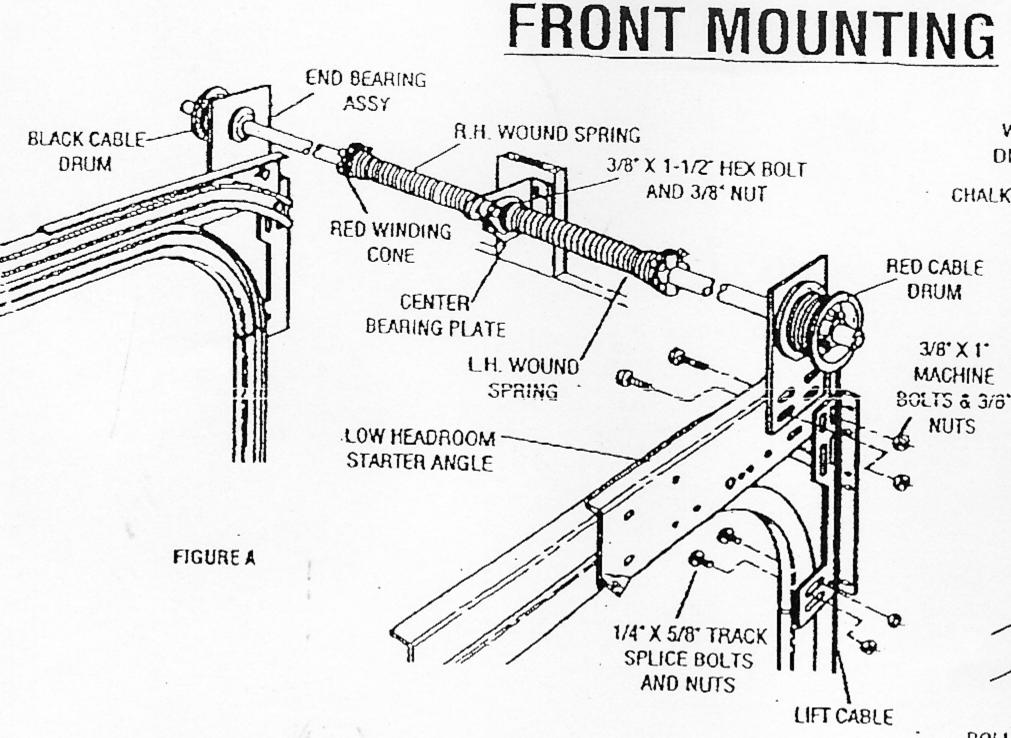


WINDING BAR 1/4 TURN AT A TIME INSERT WINDING BARINTO THE FULL DEPTH OF THE HOLE.

WINDING

DIRECTION

CHALK LINE.

NUTS

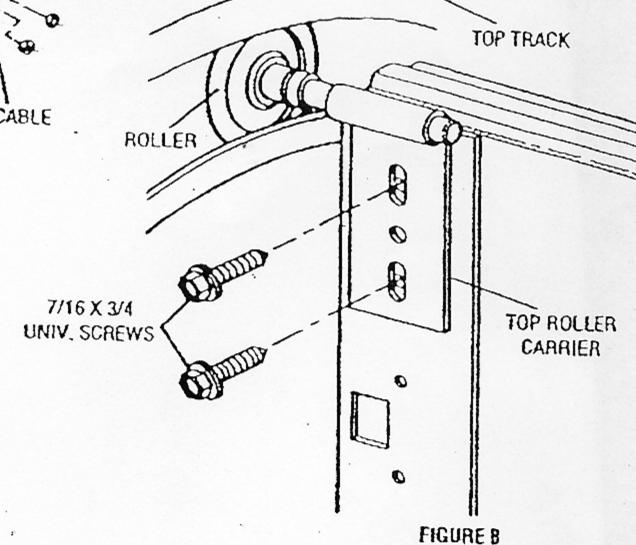

LIFT CABLE R.H. BOTTOM BRACKET **CLEVIS** 7/16' X 3/4" Oran UNIV. SCREWS COTTER PIN FIGURE C

neadroom installation requires special bottom brackets (Fig. C) and top roller carrier B) Installed to the door sections.

ent end bearing plate on low headroom starter angle.

emble torsion springs and center bearing plate and bearing on shaft as shown. en stationary cone of spring(s) to center bearing plate with 3/8' x 1 1/2' machine in (If only one spring is furnished, follow color code of spring you have.)

ant torsion spring assembly by fastening center bearing plate to center pad. Make shaft is level before fastening. Shaft must extend through bearing brackets coximately the same distance on each side.

ace cable drums on ends of shaft (outside bearing brackets) against the bearing race eeve with the set screws to outside. Black drum on left. Red on right. Secure the ble to the special bottom bracket with a clevis and cotter pin.

= ng the cable between the wall and rollers and over the top of the drum slot. Rotate c am and shaft until cable is tight. Make sure the slot is facing installer and tighten the set screws on the drum.

To keep the shaft from counter rotating use a vise grip plier braced against the header. Install the cable on the black drum in the same manner, winding the drum to make the cable tight before tightening the set screws. Wind the spring in the direction Indicated. Follow steps 8 and 9 of torsion spring installation instructions.

Install the top roller in the top carrier and insert roller in upper track of dual track as shown in Fig. B.

Make final adjustments per steps 19 to 23 of the installation instructions.



DANGER



Door is constantly under extreme spring tension. Repairs and adjustment, especially to cables and spring assembly, can be hazardous and should be performed by qualified door service people only. Invalidates the warranty.

